



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/05/2024		M57 Pretoria Road - 1619
Inspection Date	10/05/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	BMW	Registration Number	FH40BWGP
Model	328i	Register Number	
VIN	WBA3A56090NR04072	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/12/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	129,486 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Fog Light Front Left Missing	Replace
Headlight Left Defective	Repair
Door Handle Front Left Defective	Repair
Door Handle Front Right Defective	Repair
Door Handle Rear Left Defective	Repair
Door Sealing Rubber Front Right Damaged	Replace
Number Plate Front Defective	Repair
Front Bumper Residual Traces of Repair	Repair
Bonnet Residual Traces of Repair	Repair
Front Fender Left Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Rocker Panel Right Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Shock Absorber Front Left Defective	Repair
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Left Worn	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Damaged	Replace
Rim Front Left Scratched	Repair
Rim Front Right Scratched	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Scratched	Repair
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3A56090NR04072

1 / 14



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

Damage	Repair Way
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Belly plates Defective	Repair
Gearbox Oil Leak	Repair
Engine Noise Excessive	Repair
Jack Missing	Replace
Wheel Spanner Missing	Replace
Interior	Vehicle interior dirty and some panels scratched
Undercarriage	Bottom of engine and gearbox fully covered
Undercarriage	Vehicle undercarriage dirty
Tyres and rims	Vehicle has no spare wheel
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Poor residual traces of repair on some body panels
Body and Exterior	Some body panels misaligned
Electrical instruments and components	Fog light switch cracked
Tyres and rims	Front and rear tyre sizes different

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.91	3.13	-	
Rear	2.34	2.41	-	
Emergency / Parking	2.22	2.47	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40 R19	89Y	Bridgestone	Potenza	V	3515	0 mm
Front Right	245/40 R19	94Y	Michelin	Primacy	V	0711	1 mm
Rear Left	255/35 R19	96W	Lanvigator	Catchpower	V	2121	0 mm
Rear Right	255/40 R19	100Y	Goodyear	Eagle	V	5116	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	DME(ENGINE-DIGITAL MOTOR ELECTRONICS)	1D2404	MAP THERMOSTAT,ACTIVATION:LINE DISCONNECTION	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

VIN: WBA2A5G080H91069
Report No: 2016371069
2 / 14
DATE
10/05/2024

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT


Report No: 2016371069

VIN: WBA3A56090NR04072


DATE
10/05/2024

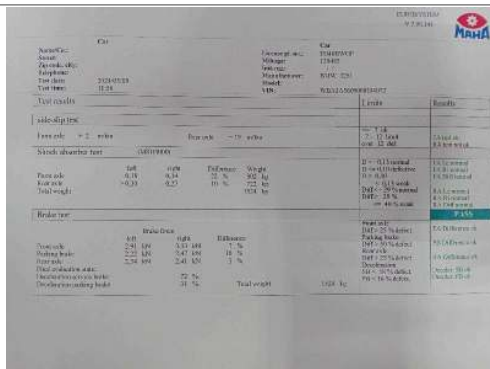

Brake and shock absorber report

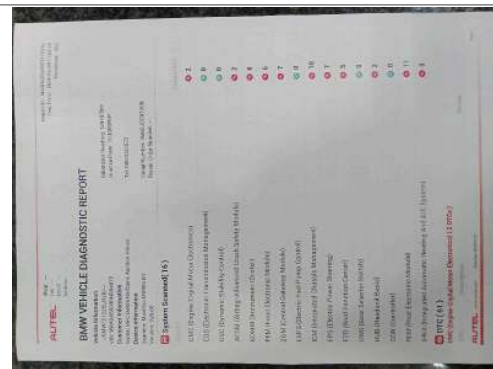


Diagnostic report page 1

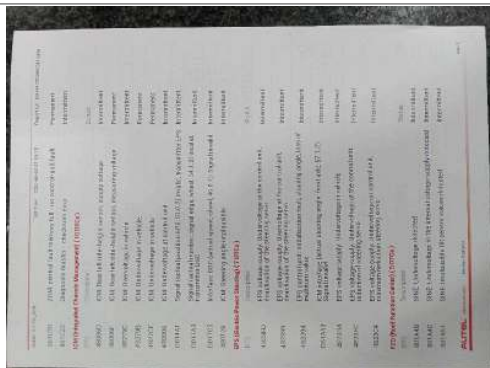

Diagnostic report page 3



Diagnostic report page 4

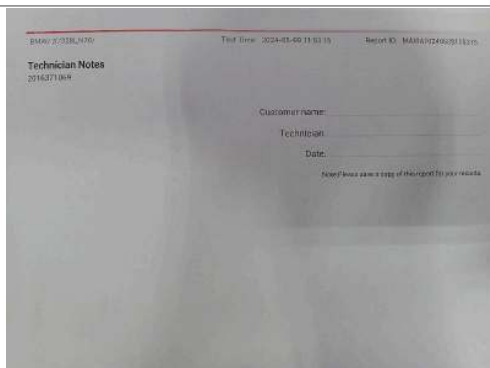

Diagnostic report page 5



FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016371069

VIN: WBA3A5609107052024
DATE: 10/05/2024
4 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

VIN: WBA3A56090NR04072

5 / 14



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic transmission



90 DEGREE FRONT



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

VIN: WBA3A56090NR04072
6 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

90 DEGREE RIGHT




90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

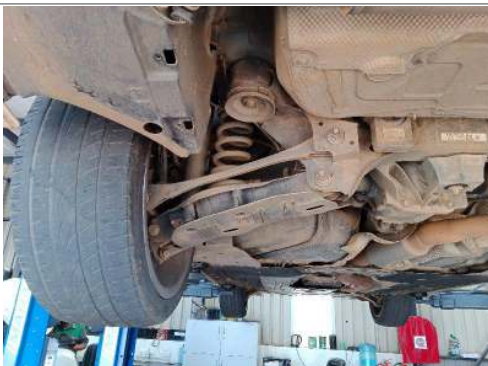

LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

VIN: WBA3A56090NR04072
8 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024



RF TYRE TREAD



Triangle



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

VIN: WBA3A56090NR04072
10 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

Rear chassis



Fog light switch



Oil cap



Door Sealing Rubber Front Right



Door Handle Front Right



Door Handle Rear Left



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

VIN: WBA3A56090NR04072
12 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

Door Handle Front Left



Windscreen

VIN: WBA3A56090NR04072

13 / 14



Fog Light Front Left



Bonnet



Rear bumper



Rear bumper



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

VIN: WBA3A56090NR04072

14 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

Water level



Rim Front Right



Door Front Right



Door Rear Right



Rocker Panel Right



Rim Rear Right



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

Bolt(s) / Nut(s) Rear Wheel Right



Bolt(s) / Nut(s) Rear Wheel Left



Rim Rear Left



Door Rear Left



Door Front Left



Front Fender Left



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

Bolt(s) / Nut(s) Front Wheel Left



Rim Front Left



Front Bumper



Front Bumper



Tyre Front Left



Belly plates



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

Belly plates



Tyre Rear Left



Tyre Rear Right



Gearbox



Control Arm Bush(es) Front Axle Left



Shock Absorber Front Left



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016371069

DATE
10/05/2024

Control Arm Bush(es) Front Axle Right



Headlight Left



Oil level



Number Plate Front

**CONDITION REPORT****Report No: 2016371069****DATE**
10/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za