



CONDITION REPORT

Report No: 2016266177

DATE
13/02/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	13/02/2024		M57 Pretoria Road - 1619
Inspection Date	13/02/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	BMW	Registration Number	CX82PXGP
Model	435I	Register Number	
VIN	WBA3T32010J868423	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/07/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	194,194 KM	Fuel	PETROL
Cab / Body Type	COUPE	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Seat Front Right Torn / Cut	Repair
Front Bumper Damaged	Repair
Bonnet Paintwork • Chipmarks	Repair
Bonnet slam plate (Shock tower/ Inner tray) Dented	Repair
Front Fender Left Dented	Repair
Front Fender Right Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Left Dented	Repair
Door Front Right Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Paintwork • Scratched	Repair
Sill Panel Right Paintwork • Scratched	Repair
Roof Paintwork • Scratched	Repair
Convertible Soft Top / Hard Top Defective	Repair
Windscreen Cracked	Replace
Tyre Front Right Torn / Cut	Replace
Silencer Missing	Replace
Belly plates Damaged	Replace
Foreign Substance On Expansion Bottle	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA3T32010J868423

1 / 13



CONDITION REPORT

Report No: 2016266177

 DATE
13/02/2024

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.6	3.6	-	
Rear	3.4	3.7	-	
Emergency / Parking	2.7	3.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/45R18	91W	Bridgestone	Turanza	V	0921	2 mm
Front Right	225/45R18	91W	Michelin	Primacy	V	1715	2 mm
Rear Left	255/40R18	95Y	Rapid	Eco sport	V	2121	3 mm
Rear Right	255/40R18	95W	Rapid	Eco sport	V	2121	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ?ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Vehicle got minor scratches, stone chips and dents on some body panels. Signs of spr

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT

VIN: WPANT321016268427

Report No: 2016268427


2 / 13

DATE


13/02/2024




Foreign substance on expansion

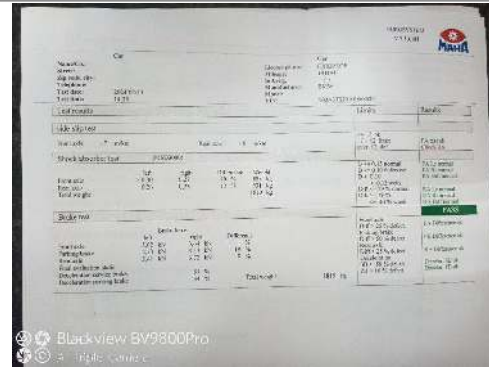

SHOCK & BRAKE REPORT

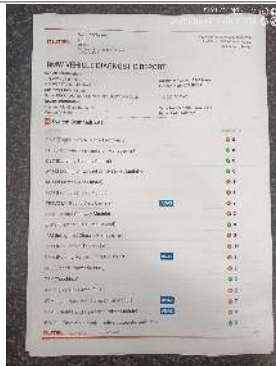

DIAGNOSTIC REPORT PAGE 1

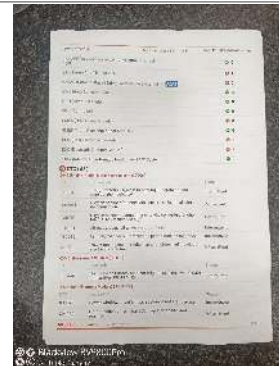

DIAGNOSTIC REPORT PAGE 2



DIAGNOSTIC REPORT PAGE 3



DIAGNOSTIC REPORT PAGE 4



CONDITION REPORT

Report No: 2016266177

VIN: WBA3T32010J868423

DATE

13/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016266177

DATE
VIN: WBA3T32010J868423
3/03/2024
4/13



DIAGNOSTIC REPORT PAGE 5




DIAGNOSTIC REPORT PAGE 6



DIAGNOSTIC REPORT PAGE 7



LICENSE DISC

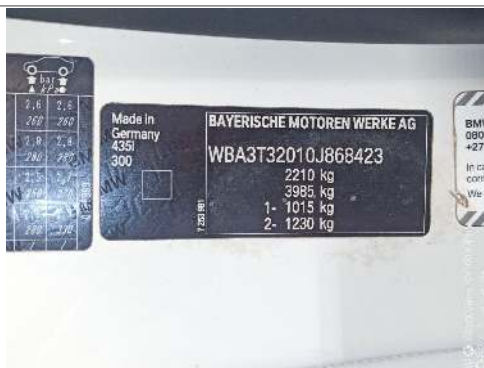

VIN PLATE OR STICKER



FRONT RIGHT CORNER



CONDITION REPORT

Report No: 2016266177

DATE
13/02/2024

VIN: WBA3T32010J868423

5 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016266177

DATE
13/02/2024

VIN: WBA3T32010J868423

6 / 13



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT



ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016266177

DATE
13/02/2024

VIN: WBA3T32010J868423

7 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016266177

DATE
13/02/2024

DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)

VIN: WBA3T32010J868423
8 / 13


Automatic



LF TYRE TREAD



RF TYRE TREAD

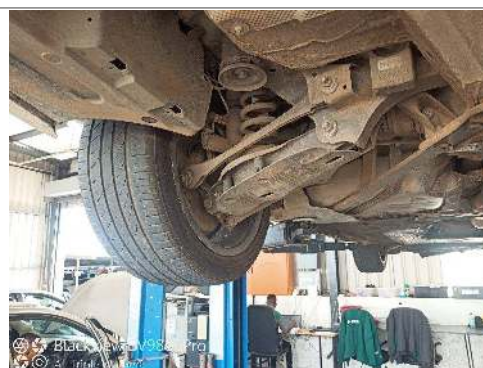

LR TYRE TREAD



CONDITION REPORT

Report No: 2016266177

DATE
13/02/2024

VIN: WBA3T32010J868423


9 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016266177

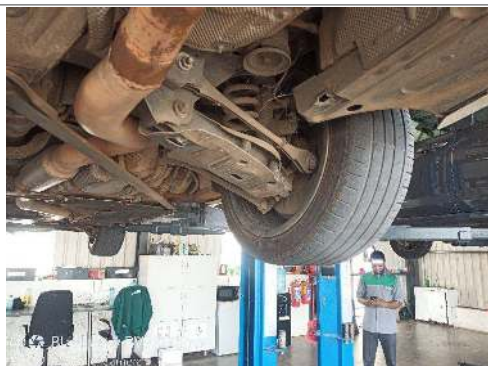DATE
13/02/2024

RR TYRE TREAD



Expansion bottle



Oil cap



No spare wheel



CHASSIS



ENGINE 2



CONDITION REPORT

Report No: 2016266177

DATE
13/02/2024

VIN: WBA3T32010J868423

11 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016266177

DATE
13/02/2024

ENGINE 1



Windscreen



Water level



Bonnet slam plate (Shock tower/ Inner tray)



Bonnet



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016266177

DATE
13/02/2024

VIN: WBA3T32010J868423
13 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016266177

DATE
13/02/2024

Front Bumper



Front Bumper



Bonnet



Front Fender Right



Convertible Soft Top / Hard Top



Door Front Right



CONDITION REPORT

Report No: 2016266177

DATE
13/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016266177

DATE
13/02/2024

Rear Fender Right



Rear bumper



Rear bumper



Door Front Left



Rear Fender Left



Sill Panel Left



CONDITION REPORT

Report No: 2016266177

DATE
13/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016266177

DATE
13/02/2024

Sill Panel Right



Sill Panel Right



Tyre Front Right



Silencer



Belly plates



Roof



CONDITION REPORT

Report No: 2016266177

DATE
13/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016266177

DATE
13/02/2024

Seat Front Right

**CONDITION REPORT****Report No: 2016266177****DATE**
13/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za