



CONDITION REPORT

Report No: 2016460350

DATE
19/07/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	19/07/2024		M57 Pretoria Road - 1619
Inspection Date	19/07/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	BMW	Registration Number	LG61DHGP
Model	320D	Register Number	
VIN	WBA5V52050AJ68774	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/07/2024
Color	GREY	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	121,600 KM	Fuel	DIESEL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Seat Front Right Excessive Wear & Tear	Repair
Front Bumper Residual Traces of Repair	Repair
Bonnet Residual Traces of Repair	Repair
Door Front Left Residual Traces of Repair	Repair
Rear bumper Damaged	Repair
Tyre Front Left Excessive Wear & Tear	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Excessive Wear & Tear	Replace
Spare Tyre Excessive Wear & Tear	Replace
Tyre Rear Right Smooth	Replace
Front tyre size	Replace.
Rear tyre size differs	Replace.
Warning lights illuminated	Repair.
Steering rack noise	Repair.



DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5V52050AJ68774

1 / 10



CONDITION REPORT

Report No: 2016460350

DATE
19/07/2024

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.0	2.7	-	
Rear	3.0	3.3	-	
Emergency / Parking	2.3	2.6	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	T135/80R17	102M	Continental	Temporary	V	4418	1 mm
Front Right	225/40R19	89Y	Continental	Contact	V	4622	0 mm
Rear Left	255/40R19	100Y	Goodyear	Eagle	V	1218	0 mm
Rear Right	255/35R19	96Y	Rovelo	RPX	V	2022	0 mm
Spare	255/35R19	92T	Continental	Contact	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	DSC	480A11	BRAKE PAD WEAR SENSOR: FRONT AXLE,REPLACE BRAKE PADS	

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Bottom of engine is fully covered.
 Body • Exterior: Signs of spray work done on some bodysuit long. Residual traces of repair work done on some body panels.
 Undercarriage: Undercarriage is fully covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT

Report No: 2016460350


DATE
19/07/2024

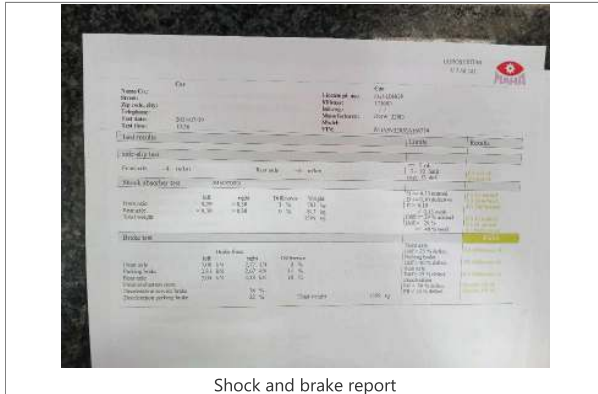


Shock and brake report

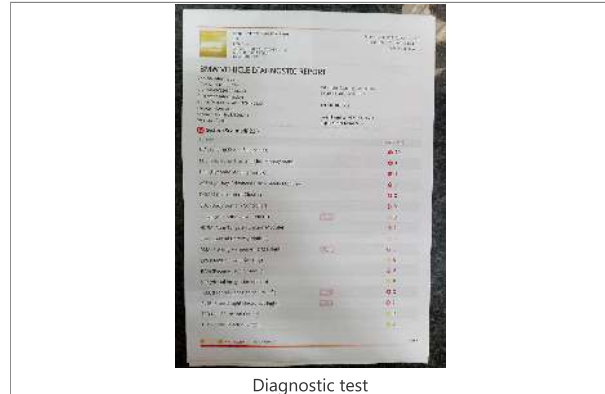


Diagnostic test

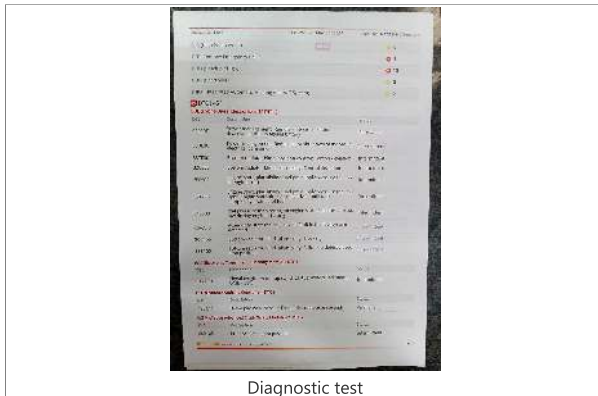

Diagnostic test

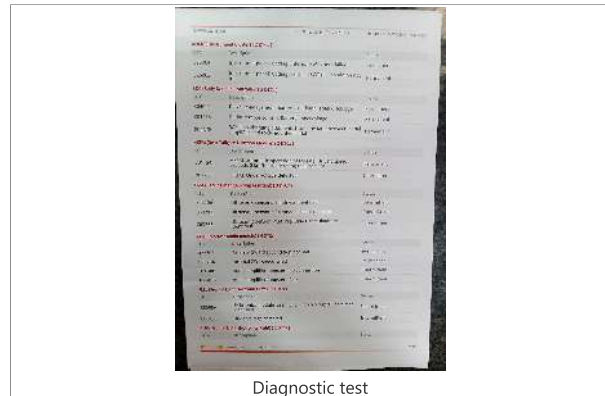

Diagnostic test

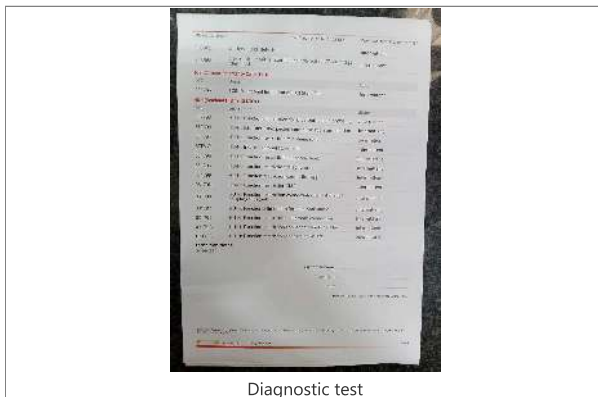

Diagnostic test



FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5V52050AJ68774

3 / 10



CONDITION REPORT

Report No: 2016460350

DATE
19/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5V52050AJ68774

4 / 10



CONDITION REPORT

Report No: 2016460350

DATE
19/07/2024



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5V52050AJ68774

5 / 10



CONDITION REPORT

Report No: 2016460350

DATE
19/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5V52050AJ68774

6 / 10



CONDITION REPORT

Report No: 2016460350

DATE
19/07/2024



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5V52050AJ68774

7 / 10



CONDITION REPORT

Report No: 2016460350

DATE
19/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5V52050AJ68774

8 / 10



CONDITION REPORT

Report No: 2016460350

DATE
19/07/2024



RF TYRE TREAD



Sparewheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CONDITION REPORT

Report No: 2016460350

DATE
19/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBA5V52050AJ68774

10 / 10



CONDITION REPORT

Report No: 2016460350

DATE
19/07/2024




CHASSIS



Rear end



Expansion bottle

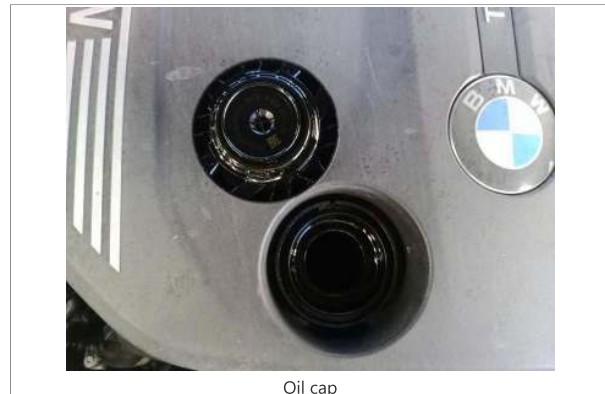

Oil cap



Service warning lights illumin



Warning lights illuminated

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016460350

DATE
19/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016460350

DATE
19/07/2024



Spare Tyre



Water level



Bonnet



Tyre Front Right



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016460350

DATE
19/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016460350

DATE
19/07/2024



Front Bumper



Front Bumper



Front Bumper



Tyre Front Left



Door Front Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016460350

DATE
19/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016460350

DATE
19/07/2024



Rear bumper



Rear bumper



Tyre Rear Left



Tyre Rear Right



Tyre Rear Right



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016460350

DATE
19/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za