



CONDITION REPORT



Report No:
2016984283
DATE
19/08/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	19/08/2025		M57 Pretoria Road - 1619
Inspection Date	19/08/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	MERCEDES-BENZ	Registration Number	JH82MJGP
Model	VITO	Register Number	
VIN	WDF44770323634341	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	GREY	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	103,324 KM	Fuel	DIESEL
Cab / Body Type	OTHERS	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WDF44770323634341



CONDITION REPORT



Report No:
2016984283
DATE
19/08/2025

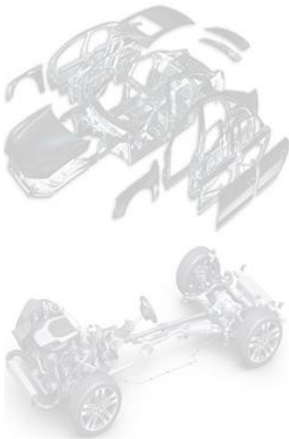	Damage	Repair Way
	Front Bumper Paintwork • Scratched	Repair
	Door Front Left Dented	Repair
	Boot Lid / Hatch door Paintwork • Scratched	Repair
	Rear bumper Paintwork • Scratched	Repair
	Body exterior	Signs of spray work done on some body panels

Brakes
Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	4.9	4.3	-	
Rear	3.5	3.7	-	
Emergency / Parking	1.6	1.4	-	

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/65R16	107/105T	Continental	Contact	V	4223	2 mm
Front Right	205/65R16	107/105T	Continental	Contact	V	4223	2 mm
Rear Left	205/65R16	107/105T	Hankook	Radial	V	5124	1 mm
Rear Right	205/65R16	107/105T	Hankook	Radial	V	5121	3 mm
Spare	205/65R16	107/105T	Hankook	Radial	V	////////	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323634341



CONDITION REPORT



Report No:
2016984283
DATE
19/08/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	SIGNAL ACQUISITION CONTROL UNIT	B25E613	RIGHT POP OUT WINDOW FAULT OPEN CIRCUIT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: BOTTOM OF ENGINE & UNDERCARRIAGE IS FULLY COVERED. ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323634341



CONDITION REPORT



Report No:
2016984283
DATE
19/08/2025



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE LEFT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323634341



CONDITION REPORT



Report No:
2016984283
DATE
19/08/2025



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)




INTERIOR (FRONT DRIVER DOOR)



Automatic



LF TYRE TREAD

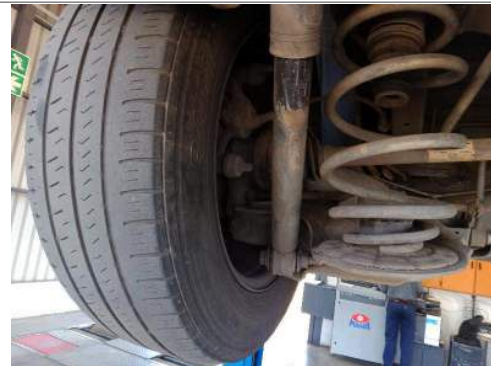

LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323634341



CONDITION REPORT



Report No:
2016984283
DATE
19/08/2025



RR TYRE TREAD



RF TYRE TREAD




Sparewheel



Oil cap and dipstick



Expansion bottle

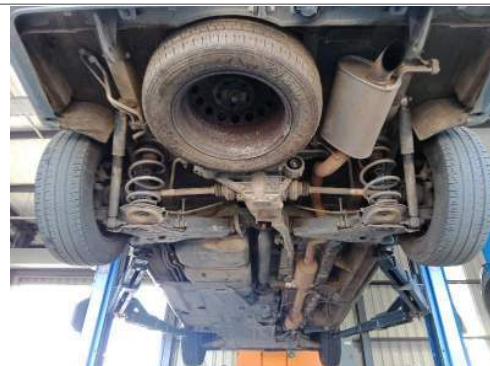

REAR CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323634341



CONDITION REPORT



Report No:
2016984283
DATE
19/08/2025



ENGINE 1



CHASSIS




ENGINE 2



VIN PLATE OR STICKER



LICENSE DISC

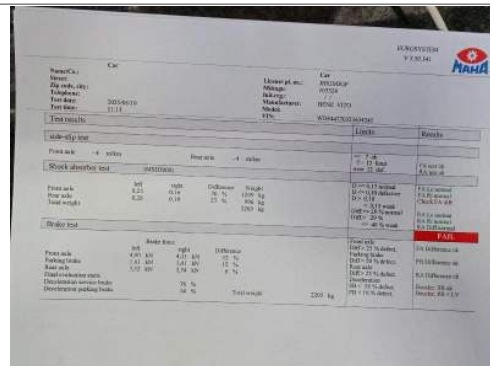

SHOCK AND BRAKE REPORT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WDF44770323634341




CONDITION REPORT




Report No:
2016984283
DATE
19/08/2025

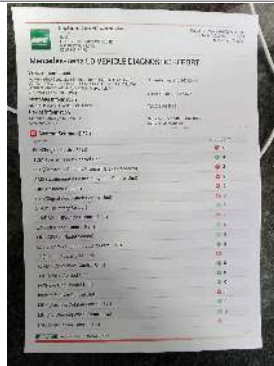


DIAGNOSTIC REPORT PAGE 1

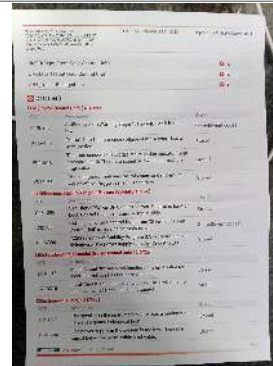

DIAGNOSTIC REPORT PAGE 2

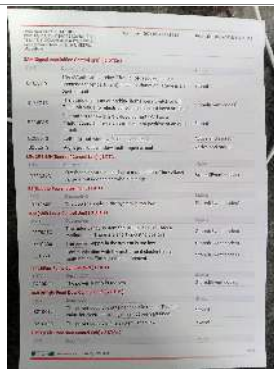

DIAGNOSTIC REPORT PAGE 3

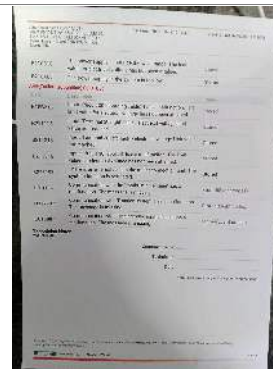

DIAGNOSTIC REPORT PAGE 4



Boot Lid / Hatch door



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323634341



CONDITION REPORT



Report No:
2016984283
DATE
19/08/2025



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323634341

**CONDITION REPORT**

Report No:
2016984283
DATE
19/08/2025



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF44770323634341