



CONDITION REPORT

Report No: 2016230764

DATE  
16/01/2024

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	16/01/2024		M57 Pretoria Road - 1619
Inspection Date	16/01/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	VOLKSWAGEN	Registration Number	LB91ZTGP
Model	TIGUAN	Register Number	
VIN	WVGZZZ5NZJW980511	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	29/02/2024
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	136,277 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Bonnet stay and shocks Defective	Replace
Windscreen Wiper Damaged	Replace
Headlight Left Scratched	Replace
Seat Front Left Dirty	Repair
Seat Front Right Defective	Repair
Seat Rear Defective	Repair
Hood Lining Dirty	Repair
Steering Wheel Trim Defective	Repair
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Bonnet Paintwork • Chipmarks	Repair
C • Pillar Left Dented	Repair
C • Pillar Right Dented	Repair
Front Fender Left Damaged	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Dented	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Right Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Shock Absorber Front Right Sweat	Replace
Spare Tyre Worn	Replace
Belly plates Damaged	Replace
Engine Noise Excessive	Repair

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WVGZZZ5NZJW980511



## CONDITION REPORT

Report No: 2016230764

DATE  
16/01/2024

### Brakes

#### Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	3.7	4.05	-	
Rear	3.23	4.11	-	
Emergency / Parking	2.55	2.57	-	

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/65 R17	99H	Royalblack	Sport	V	3322	4 mm
Front Right	215/65 R17	99H	Royalblack	Sport	V	3322	4 mm
Rear Left	215/65 R17	99H	Royalblack	Sport	V	3222	5 mm
Rear Right	215/65 R17	99H	Royalblack	Sport	V	3322	5 mm
Spare	215/65 R17	99V	Falken	Ziex	V		0 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	U112300	DATABUS ERROR VALUE RECEIVED	

### Inspection Conditions

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: AIRBAG AND TYRE PRESSURE WARNING LIGHTS ILLUMINATED ON DASHBOARD.Engine Compartment: Engine bay dirty.Brake fluid level ok.Oil sweat on brake booster reservoir.  
Interior: Vehicle interior dirty and some interior panels scratched.  
Body • Ext

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

### Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za




# CONDITION REPORT

VIN: WA1G775021M1690764  
Report No: 2016230764

2 / 13  
DATE

16/01/2024

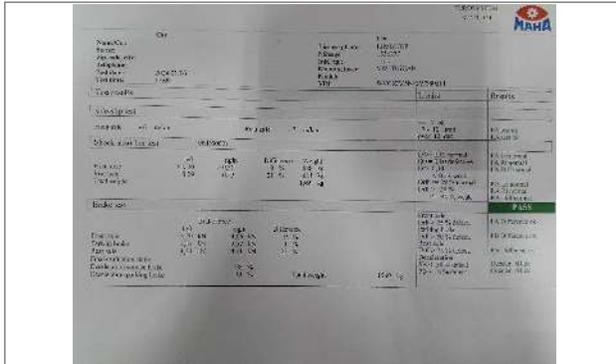

Brake and shock absorber report



Diagnostic report page 1



Diagnostic report page 2



Diagnostic report page 3



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016230764**

VIN: WVGZZZ5NZJW980511

DATE

16/01/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016230764

DATE: 16/01/2024  
VIN: WVGZZZ5N7400124  
4 / 13



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016230764**

**DATE**  
**16/01/2024**

VIN: WVGZZZ5NZJW980511

5 / 13

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016230764

DATE  
16/01/2024

VIN: WVGZZZ5NZJW980511


6 / 13



90 DEGREE LEFT



LF TYRE TREAD

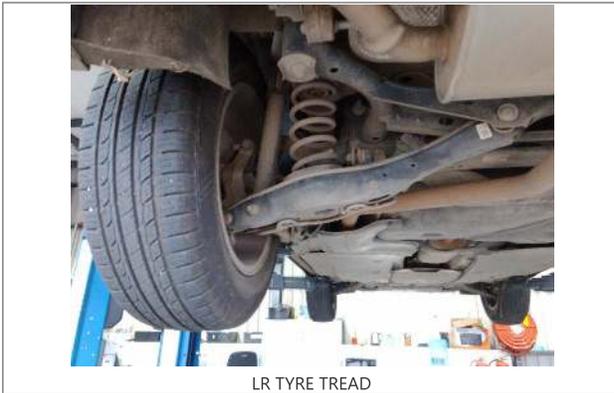

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016230764

DATE  
16/01/2024

VIN: WVGZZZ5NZJW980511

7 / 13

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016230764

DATE  
16/01/2024



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Automatic Transmission

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016230764

DATE  
16/01/2024

VIN: WVGZZZ5NZJW980511

9 / 13

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016230764

DATE  
16/01/2024



Oil cap and dipstick



C • Pillar Right

WVGZZZ5NZJW980511  
10 / 13



Seat Rear



Seat Rear



C • Pillar Left



Seat Front Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016230764**

**DATE**  
**16/01/2024**

VIN: WVGZZZ5NZJW980511

11 / 13

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016230764

DATE  
16/01/2024



Hood Lining



Windscreen



Side Mirror Left



Front Bumper



Front Bumper



Bonnet

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016230764

DATE  
16/01/2024

VIN: WVGZZZ5NZJW980511

13 / 13

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016230764

DATE  
16/01/2024



Headlight Left



Sill Panel Right



Seat Front Right



Steering Wheel Trim



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016230764

DATE  
16/01/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016230764

DATE  
16/01/2024



Windscreen Wiper



Engine



Spare Tyre



Boot Lid / Hatch door



Shock Absorber Front Right



Door Front Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016230764

DATE  
16/01/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016230764

DATE  
16/01/2024



Door Rear Right



Rear Fender Right



Rear Fender Left



Door Rear Left



Door Front Left



Front Fender Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016230764

DATE  
16/01/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016230764

DATE  
16/01/2024



Front Bumper



Belly plates



Belly plates



Water level



Bonnet stay and shocks

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016230764**

**DATE**  
**16/01/2024**

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za