



CONDITION REPORT



Report No:
2016998056
DATE
01/09/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	01/09/2025		M57 Pretoria Road - 1619
Inspection Date	01/09/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	CK15MKGP
Model	POLO SEDAN 1.6 COMFORTLINE [2011-2015]	Register Number	
VIN	WVWZZZ60ZDT032441	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/08/2025
Color	WHITE	Power / Displacement	
Year Model	2013	Paint Finish	TWO COAT UNI
Km Reading	187,940 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WVWZZZ60ZDT032441



CONDITION REPORT



Report No:
2016998056
DATE
01/09/2025

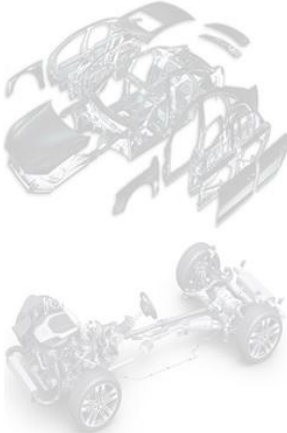	Damage	Repair Way
	Engine Oil Leak Headlight Left Damaged Headlight Right Damaged Front Bumper Damaged Bonnet Damaged Front Fender Left Damaged Front Fender Right Damaged Rear Fender Right Damaged Door Rear Left Damaged Door Rear Right Damaged Rear bumper Damaged Windscreen Damaged Tyre Rear Left Worn	Repair Replace Replace Repair Repair Repair Repair Repair Repair Repair Repair Replace Replace

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.92	2.75	-	
Rear	1.86	1.74	-	
Emergency / Parking	0.77	1.04	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	84H	Continental	Contipremiu	V	0221	1 mm
Front Right	185/60R15	88H	Dunlop	Sp	V	1224	2 mm
Rear Left	185/60R15	84H	Continental	Contipremiu	V	0321	0 mm
Rear Right	185/60R15	84H	Continental	Contipremiu	V	0221	1 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ60ZDT032441



CONDITION REPORT



Report No:
2016998056
DATE
01/09/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ELECTRONIC CENTRAL ELECTRIC	03591:011	SIGNAL HORN ACTIVATION - OPEN CIRCUIT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels. Vehicle body in poor condition.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WVVZZZ60ZDT032441




CONDITION REPORT




Report No:
2016998056
DATE
01/09/2025

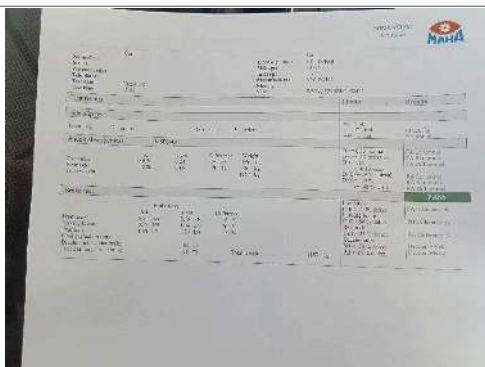

Brake test.

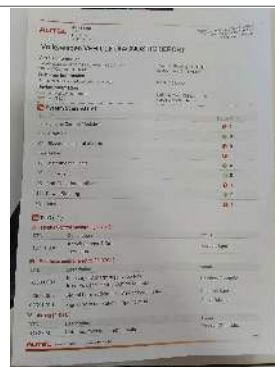

Diagnostic.

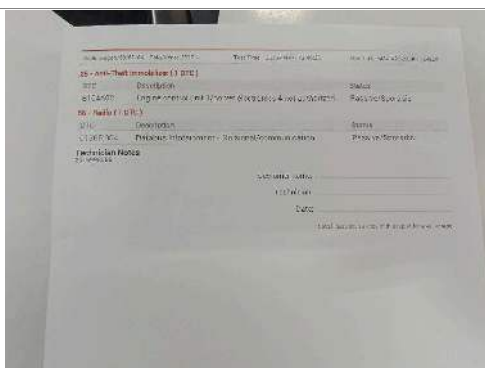

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZZ60ZDT032441



CONDITION REPORT



Report No:
2016998056
DATE
01/09/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ60ZDT032441



CONDITION REPORT



Report No:
2016998056
DATE
01/09/2025



90 DEGREE LEFT




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

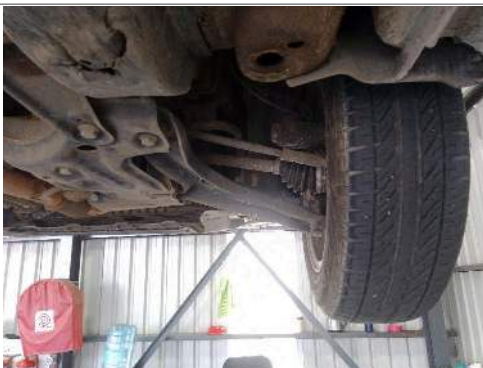

RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ60ZDT032441



CONDITION REPORT




Report No:
2016998056
DATE
01/09/2025



VIN PLATE OR STICKER



ENGINE 1

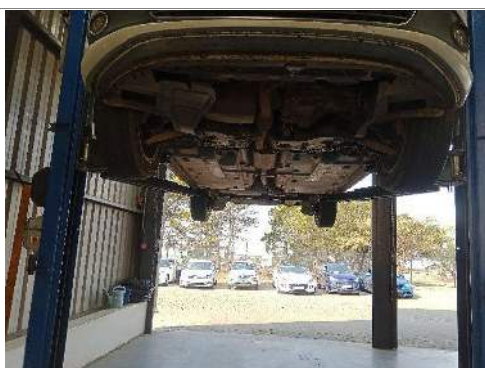

Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ60ZDT032441



CONDITION REPORT



Report No:
2016998056
DATE
01/09/2025




Headlight Right



Headlight Left




Front Bumper

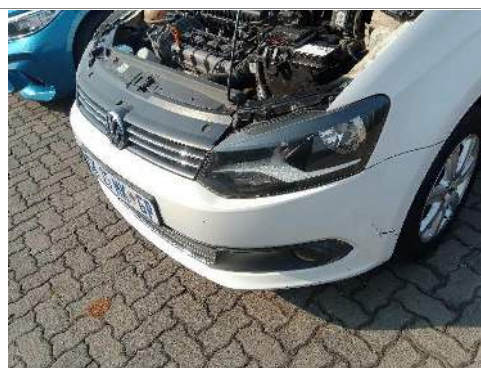

Front Bumper



Bonnet

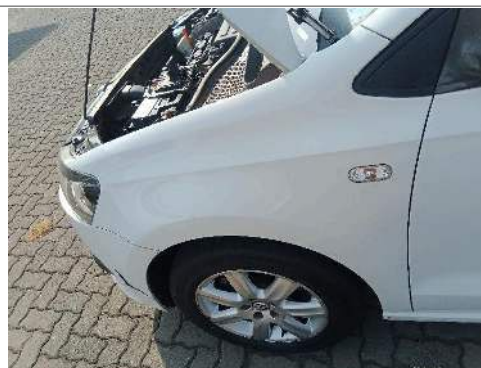

Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ60ZDT032441



CONDITION REPORT



Report No:
2016998056
DATE
01/09/2025



Door Rear Left




Rear bumper



Rear bumper



Rear Fender Right

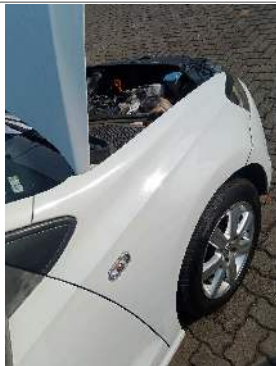

Front Fender Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ60ZDT032441



CONDITION REPORT



Report No:
2016998056
DATE
01/09/2025



Windscreen



Tyre Rear Left



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ60ZDT032441